

SAFETY DATA SHEETS

This SDS packet was issued with item:

071295823

The safety data sheets (SDS) in this packet apply to the individual products listed below. Please refer to invoice for specific item number(s).

071221027 071221035 071222942 071222967 071222975 071222983 071222991 071223676 071223684 071223692
071223700 071223718 071223726 071223734 071223742 071229251 071229269 071229277 071229293 071229301
071295773 071295781 071295799 071295807 071295815 071295831 071295849 071295856 071295864 071295872
071295880 071295930 510014202

Guttapercha Points

Coltène/Whaledent GmbH & Co. KG

Version No: 2.2

Safety Data Sheet according to OSHA HazCom Standard (2012) requirements

Issue Date: 02/11/2022

Print Date: 13/11/2023

S.GHS.USA.EN

SECTION 1 Identification

Product Identifier

Product name	Guttapercha Points
Synonyms	Not Available
Proper shipping name	Environmentally hazardous substance, solid, n.o.s. (contains zinc oxide)
Other means of identification	Not Available

Recommended use of the chemical and restrictions on use

Relevant identified uses	Medical device, for dental use only Use according to manufacturer's directions.
--------------------------	--

Name, address, and telephone number of the chemical manufacturer, importer, or other responsible party

Registered company name	Coltène/Whaledent GmbH & Co. KG
Address	Raiffeisenstrasse 30 89129 Langenau Germany
Telephone	+49 (7345) 805 0
Fax	+49 (7345) 805 201
Website	www.coltene.com
Email	msds@coltene.com

Emergency phone number


Association / Organisation	CHEMWATCH EMERGENCY RESPONSE (24/7)
Emergency telephone numbers	+1 855-237-5573
Other emergency telephone numbers	+61 3 9573 3188

Once connected and if the message is not in your preferred language then please dial 01

Una vez conectado y si el mensaje no está en su idioma preferido, por favor marque 02

SECTION 2 Hazard(s) identification

Classification of the substance or mixture

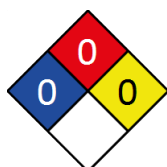

Note: The hazard category numbers found in GHS classification in section 2 of this SDSs are NOT to be used to fill in the NFPA 704 diamond. Blue = Health Red = Fire Yellow = Reactivity White = Special (Oxidizer or water reactive substances)

Classification	Hazardous to the Aquatic Environment Acute Hazard Category 1, Hazardous to the Aquatic Environment Long-Term Hazard Category 1
----------------	--

Label elements

Guttapercha Points

Hazard pictogram(s)	
---------------------	---

Signal word	Warning
-------------	---------

Hazard statement(s)

H410	Very toxic to aquatic life with long lasting effects.
------	---

Hazard(s) not otherwise classified

Not Applicable

Precautionary statement(s) Prevention

P273	Avoid release to the environment.
------	-----------------------------------

Precautionary statement(s) Response

P391	Collect spillage.
------	-------------------

Precautionary statement(s) Storage

Not Applicable

Precautionary statement(s) Disposal

P501	Dispose of contents/container to authorised hazardous or special waste collection point in accordance with any local regulation.
------	--

SECTION 3 Composition / information on ingredients

Substances

See section below for composition of Mixtures

Mixtures

CAS No	%[weight]	Name
1314-13-2	50-70	<u>zinc oxide</u>
13463-67-7	1-5	<u>C.I. Pigment White 6</u>

The specific chemical identity and/or exact percentage (concentration) of composition has been withheld as a trade secret.

SECTION 4 First-aid measures

Description of first aid measures

Eye Contact	If this product comes in contact with eyes: ▶ Wash out immediately with water. ▶ If irritation continues, seek medical attention. ▶ Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.
Skin Contact	If skin or hair contact occurs: ▶ Flush skin and hair with running water (and soap if available). ▶ Seek medical attention in event of irritation.
Inhalation	▶ If fumes, aerosols or combustion products are inhaled remove from contaminated area. ▶ Other measures are usually unnecessary.
Ingestion	▶ Immediately give a glass of water. ▶ First aid is not generally required. If in doubt, contact a Poisons Information Centre or a doctor.

Most important symptoms and effects, both acute and delayed

See Section 11

Indication of any immediate medical attention and special treatment needed

Continued...

Treat symptomatically.

SECTION 5 Fire-fighting measures

Extinguishing media

- ▶ Water spray or fog.
- ▶ Foam.
- ▶ Dry chemical powder.
- ▶ BCF (where regulations permit).
- ▶ Carbon dioxide.

Special hazards arising from the substrate or mixture

Fire Incompatibility	None known.
----------------------	-------------

Special protective equipment and precautions for fire-fighters

Fire Fighting	▶ Alert Fire Brigade and tell them location and nature of hazard. ▶ Wear breathing apparatus plus protective gloves in the event of a fire. ▶ Prevent, by any means available, spillage from entering drains or water courses. ▶ Use fire fighting procedures suitable for surrounding area. ▶ DO NOT approach containers suspected to be hot. ▶ Cool fire exposed containers with water spray from a protected location. ▶ If safe to do so, remove containers from path of fire. ▶ Equipment should be thoroughly decontaminated after use.
Fire/Explosion Hazard	▶ Non combustible. ▶ Not considered a significant fire risk, however containers may burn. Decomposition may produce toxic fumes of: metal oxides

SECTION 6 Accidental release measures

Personal precautions, protective equipment and emergency procedures

See section 8

Environmental precautions

See section 12

Methods and material for containment and cleaning up

Minor Spills	Environmental hazard - contain spillage. ▶ Clean up all spills immediately. ▶ Avoid contact with skin and eyes. ▶ Wear impervious gloves and safety glasses. ▶ Use dry clean up procedures and avoid generating dust. ▶ Vacuum up (consider explosion-proof machines designed to be grounded during storage and use). ▶ Do NOT use air hoses for cleaning ▶ Place spilled material in clean, dry, sealable, labelled container.
Major Spills	Environmental hazard - contain spillage. ▶ Clear area of personnel and move upwind. ▶ Alert Fire Brigade and tell them location and nature of hazard. ▶ Control personal contact with the substance, by using protective equipment and dust respirator. ▶ Prevent spillage from entering drains, sewers or water courses. ▶ Avoid generating dust. ▶ Sweep, shovel up. Recover product wherever possible. ▶ Put residues in labelled plastic bags or other containers for disposal. ▶ If contamination of drains or waterways occurs, advise emergency services.

Personal Protective Equipment advice is contained in Section 8 of the SDS.

SECTION 7 Handling and storage

Guttapercha Points

Precautions for safe handling

Safe handling	▶ Limit all unnecessary personal contact. ▶ Wear protective clothing when risk of exposure occurs. ▶ Use in a well-ventilated area. ▶ Avoid contact with incompatible materials. ▶ When handling, DO NOT eat, drink or smoke. ▶ Avoid physical damage to containers. ▶ Always wash hands with soap and water after handling. ▶ Work clothes should be laundered separately. ▶ Use good occupational work practice.
Other information	▶ Store in original containers. ▶ Keep containers securely sealed. ▶ Store away from incompatible materials and foodstuff containers.

Conditions for safe storage, including any incompatibilities

Suitable container	▶ Packing as recommended by manufacturer. ▶ Check all containers are clearly labelled and free from leaks.
Storage incompatibility	▶ Store in original containers. ▶ Store in a cool, dry area protected from environmental extremes. ▶ Store away from incompatible materials and foodstuff containers.

SECTION 8 Exposure controls / personal protection

Control parameters

Occupational Exposure Limits (OEL)

INGREDIENT DATA

Source	Ingredient	Material name	TWA	STEL	Peak	Notes
US OSHA Permissible Exposure Limits (PELs) Table Z-1	zinc oxide	Zinc oxide- Total dust	15 mg/m3	Not Available	Not Available	Not Available
US OSHA Permissible Exposure Limits (PELs) Table Z-1	zinc oxide	Zinc oxide fume	5 mg/m3	Not Available	Not Available	Not Available
US OSHA Permissible Exposure Limits (PELs) Table Z-1	zinc oxide	Zinc oxide- Respirable fraction	5 mg/m3	Not Available	Not Available	Not Available
US OSHA Permissible Exposure Limits (PELs) Table Z-3	zinc oxide	Inert or Nuisance Dust: Total Dust	15 mg/m3 / 50 mppcf	Not Available	Not Available	Not Available
US OSHA Permissible Exposure Limits (PELs) Table Z-3	zinc oxide	Inert or Nuisance Dust: Respirable fraction	5 mg/m3 / 15 mppcf	Not Available	Not Available	Not Available
US NIOSH Recommended Exposure Limits (RELs)	zinc oxide	Zinc oxide - Dust	5 mg/m3	Not Available	15 mg/m3	Not Available
US NIOSH Recommended Exposure Limits (RELs)	zinc oxide	Zinc oxide - Fume	5 mg/m3	10 mg/m3	Not Available	Not Available
US OSHA Permissible Exposure Limits (PELs) Table Z-1	C.I. Pigment White 6	Titanium dioxide - Total dust	15 mg/m3	Not Available	Not Available	Not Available
US OSHA Permissible Exposure Limits (PELs) Table Z-3	C.I. Pigment White 6	Inert or Nuisance Dust: Total Dust	15 mg/m3 / 50 mppcf	Not Available	Not Available	Not Available
US OSHA Permissible Exposure Limits (PELs) Table Z-3	C.I. Pigment White 6	Inert or Nuisance Dust: Respirable fraction	5 mg/m3 / 15 mppcf	Not Available	Not Available	Not Available
US NIOSH Recommended Exposure Limits (RELs)	C.I. Pigment White 6	Titanium dioxide	Not Available	Not Available	Not Available	Ca; See Appendix A

Emergency Limits

Guttapercha Points

Ingredient	TEEL-1	TEEL-2	TEEL-3
zinc oxide	10 mg/m3	15 mg/m3	2,500 mg/m3
C.I. Pigment White 6	30 mg/m3	330 mg/m3	2,000 mg/m3

Ingredient	Original IDLH	Revised IDLH
zinc oxide	500 mg/m3	Not Available
C.I. Pigment White 6	5,000 mg/m3	Not Available

Exposure controls

Engineering controls are used to remove a hazard or place a barrier between the worker and the hazard. Well-designed engineering controls can be highly effective in protecting workers and will typically be independent of worker interactions to provide this high level of protection. The basic types of engineering controls are: Process controls which involve changing the way a job activity or process is done to reduce the risk. Enclosure and/or isolation of emission source which keeps a selected hazard 'physically' away from the worker and ventilation that strategically 'adds' and 'removes' air in the work environment. Ventilation can remove or dilute an air contaminant if designed properly. The design of a ventilation system must match the particular process and chemical or contaminant in use. Employers may need to use multiple types of controls to prevent employee overexposure. ▶ Local exhaust ventilation is required where solids are handled as powders or crystals; even when particulates are relatively large, a certain proportion will be powdered by mutual friction. ▶ If in spite of local exhaust an adverse concentration of the substance in air could occur, respiratory protection should be considered. Such protection might consist of: (a): particle dust respirators, if necessary, combined with an absorption cartridge; (b): filter respirators with absorption cartridge or canister of the right type; (c): fresh-air hoods or masks. Air contaminants generated in the workplace possess varying 'escape' velocities which, in turn, determine the 'capture velocities' of fresh circulating air required to effectively remove the contaminant.	
--	--

Type of Contaminant:	Air Speed:
direct spray, spray painting in shallow booths, drum filling, conveyer loading, crusher dusts, gas discharge (active generation into zone of rapid air motion)	1-2.5 m/s (200-500 f/min.)
grinding, abrasive blasting, tumbling, high speed wheel generated dusts (released at high initial velocity into zone of very high rapid air motion).	2.5-10 m/s (500-2000 f/min.)

Within each range the appropriate value depends on:

Lower end of the range	Upper end of the range
1: Room air currents minimal or favourable to capture	1: Disturbing room air currents
2: Contaminants of low toxicity or of nuisance value only.	2: Contaminants of high toxicity
3: Intermittent, low production.	3: High production, heavy use
4: Large hood or large air mass in motion	4: Small hood-local control only

Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple extraction pipe. Velocity generally decreases with the square of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point should be adjusted, accordingly, after reference to distance from the contaminating source. The air velocity at the extraction fan, for example, should be a minimum of 4-10 m/s (800-2000 f/min) for extraction of crusher dusts generated 2 metres distant from the extraction point. Other mechanical considerations, producing performance deficits within the extraction apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more when extraction systems are installed or used.

Individual protection measures, such as personal protective equipment	
Eye and face protection	▶ Safety glasses with side shields ▶ Chemical goggles. [AS/NZS 1337.1, EN166 or national equivalent] ▶ Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lenses or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59].

Guttapercha Points

Skin protection	See Hand protection below
Hands/feet protection	Experience indicates that the following polymers are suitable as glove materials for protection against undissolved, dry solids, where abrasive particles are not present. ▶ polychloroprene. ▶ nitrile rubber. ▶ butyl rubber. ▶ fluorocautchouc. ▶ polyvinyl chloride. Gloves should be examined for wear and/ or degradation constantly.
Body protection	See Other protection below
Other protection	No special equipment needed when handling small quantities. OTHERWISE: ▶ Overall. ▶ Barrier cream. ▶ Eyewash unit.

SECTION 9 Physical and chemical properties

Information on basic physical and chemical properties

Appearance	Not Available	
Physical state	Solid	Relative density (Water = 1)
Odour	Not Available	Partition coefficient n-octanol / water
Odour threshold	Not Available	Auto-ignition temperature (°C)
pH (as supplied)	Not Available	Decomposition temperature (°C)
Melting point / freezing point (°C)	Not Available	Viscosity (cSt)
Initial boiling point and boiling range (°C)	Not Available	Molecular weight (g/mol)
Flash point (°C)	Not Available	Taste
Evaporation rate	Not Available	Explosive properties
Flammability	Not Available	Oxidising properties
Upper Explosive Limit (%)	Not Available	Surface Tension (dyn/cm or mN/m)
Lower Explosive Limit (%)	Not Available	Volatile Component (%vol)
Vapour pressure (kPa)	Not Available	Gas group
Solubility in water	Immiscible	pH as a solution (1%)
Vapour density (Air = 1)	Not Available	VOC g/L

SECTION 10 Stability and reactivity

Reactivity	See section 7
Chemical stability	▶ Unstable in the presence of incompatible materials. ▶ Product is considered stable. ▶ Hazardous polymerisation will not occur.
Possibility of hazardous reactions	See section 7

Guttapercha Points

Conditions to avoid	See section 7
Incompatible materials	See section 7
Hazardous decomposition products	See section 5

SECTION 11 Toxicological information

Information on toxicological effects

Guttapercha Points	TOXICITY	IRRITATION
	Not Available	Not Available
zinc oxide	TOXICITY	IRRITATION
	dermal (rat) LD50: >2000 mg/kg ^[1]	Eye (rabbit) : 500 mg/24 h - mild
	Inhalation(Rat) LC50: >1.79 mg/l4h ^[1]	Eye: no adverse effect observed (not irritating) ^[1]
	Oral (Rat) LD50: >5000 mg/kg ^[1]	Skin (rabbit) : 500 mg/24 h- mild
		Skin: no adverse effect observed (not irritating) ^[1]
C.I. Pigment White 6	TOXICITY	IRRITATION
	dermal (hamster) LD50: >=10000 mg/kg ^[2]	Eye: no adverse effect observed (not irritating) ^[1]
	Inhalation(Rat) LC50: >2.28 mg/l4h ^[1]	Skin (rabbit) Draize 0.3mg/3hrInt Mild
	Oral (Rat) LD50: >=2000 mg/kg ^[1]	Skin: no adverse effect observed (not irritating) ^[1]
Legend:	1. Value obtained from Europe ECHA Registered Substances - Acute toxicity 2. Value obtained from manufacturer's SDS. Unless otherwise specified data extracted from RTECS - Register of Toxic Effect of chemical Substances	

Acute Toxicity	✗	Carcinogenicity	✗
Skin Irritation/Corrosion	✗	Reproductivity	✗
Serious Eye Damage/Irritation	✗	STOT - Single Exposure	✗
Respiratory or Skin sensitisation	✗	STOT - Repeated Exposure	✗
Mutagenicity	✗	Aspiration Hazard	✗

Legend: ✗ – Data either not available or does not fill the criteria for classification
 ✓ – Data available to make classification

SECTION 12 Ecological information

Toxicity

Guttapercha Points	Endpoint	Test Duration (hr)	Species	Value	Source
	Not Available	Not Available	Not Available	Not Available	Not Available
zinc oxide	Endpoint	Test Duration (hr)	Species	Value	Source
	BCF	1344h	Fish	19-110	7
	EC50	72h	Algae or other aquatic plants	0.022mg/L	2
	EC50	48h	Crustacea	0.105mg/L	2
	EC50	96h	Algae or other aquatic plants	0.042mg/L	2
	ErC50	72h	Algae or other aquatic plants	0.62mg/l	2
	LC50	96h	Fish	0.102mg/L	2
	EC10(ECx)	168h	Algae or other aquatic plants	0.003mg/L	2

Continued...

Guttapercha Points

C.I. Pigment White 6	Endpoint	Test Duration (hr)	Species	Value	Source
	BCF	1008h	Fish	<1.1-9.6	7
	EC50	72h	Algae or other aquatic plants	3.75-7.58mg/l	4
	EC50	48h	Crustacea	1.9mg/l	2
	EC50	96h	Algae or other aquatic plants	179.05mg/l	2
	LC50	96h	Fish	1.85-3.06mg/l	4
	NOEC(ECx)	672h	Fish	>=0.004mg/L	2

Legend: *Extracted from 1. IUCLID Toxicity Data 2. Europe ECHA Registered Substances - Ecotoxicological Information - Aquatic Toxicity 4. US EPA, Ecotox database - Aquatic Toxicity Data 5. ECETOC Aquatic Hazard Assessment Data 6. NITE (Japan) - Bioconcentration Data 7. METI (Japan) - Bioconcentration Data 8. Vendor Data*

Very toxic to aquatic organisms, may cause long-term adverse effects in the aquatic environment.

Persistence and degradability

Ingredient	Persistence: Water/Soil	Persistence: Air
C.I. Pigment White 6	HIGH	HIGH

Bioaccumulative potential

Ingredient	Bioaccumulation
zinc oxide	LOW (BCF = 217)
C.I. Pigment White 6	LOW (BCF = 10)

Mobility in soil

Ingredient	Mobility
C.I. Pigment White 6	LOW (KOC = 23.74)

SECTION 13 Disposal considerations

Waste treatment methods

Product / Packaging disposal	Dispose of waste according to applicable legislation. Special country-specific regulations may apply. Can be disposed together with household waste in compliance with official regulations in contact with approved waste disposal companies and with authorities in charge. (Only dispose of completely emptied packages.)
------------------------------	--

SECTION 14 Transport information

Labels Required

	
Marine Pollutant	

Shipping container and transport vehicle placarding and labeling may vary from the below information. Products that are regulated for transport will be packaged and marked as Dangerous Goods in Limited Quantities according to US DOT, IATA and IMDG regulations. In case of reshipment, it is the responsibility of the shipper to determine the appropriate labels and markings in accordance with applicable transport regulations.

Land transport (DOT)

14.1. UN number or ID number	3077
------------------------------	------

Guttafercha Points

14.2. UN proper shipping name	Environmentally hazardous substance, solid, n.o.s. (contains zinc oxide)		
14.3. Transport hazard class(es)	Class	9	
	Subsidiary Hazard	Not Applicable	
14.4. Packing group	III		
14.5. Environmental hazard	Environmentally hazardous		
14.6. Special precautions for user	Hazard Label	9	
	Special provisions	8, 146, 335, 384, 441, A112, B54, B120, IB8, IP3, N20, N91, T1, TP33	

For Individual Packages of Environmentally Hazardous Substances meeting the descriptions of UN 3077 or UN 3082 that contain LESS THAN the reportable quantity (5 kg or 5 L) - Not Regulated
For Individual Packages of Environmentally Hazardous Substances meeting the descriptions of UN 3077 or UN 3082 that contain MORE THAN the reportable quantity (5 kg or 5 L) - Regulated and classified as below:

Air transport (ICAO-IATA / DGR)

14.1. UN number	3077		
14.2. UN proper shipping name	Environmentally hazardous substance, solid, n.o.s. (contains zinc oxide)		
14.3. Transport hazard class(es)	ICAO/IATA Class		9
	ICAO / IATA Subsidiary Hazard		Not Applicable
	ERG Code		9L
14.4. Packing group	III		
14.5. Environmental hazard	Environmentally hazardous		
14.6. Special precautions for user	Special provisions		A97 A158 A179 A197 A215
	Cargo Only Packing Instructions		956
	Cargo Only Maximum Qty / Pack		400 kg
	Passenger and Cargo Packing Instructions		956
	Passenger and Cargo Maximum Qty / Pack		400 kg
	Passenger and Cargo Limited Quantity Packing Instructions		Y956
	Passenger and Cargo Limited Maximum Qty / Pack		30 kg G

Sea transport (IMDG-Code / GGVSee)

14.1. UN number	3077		
14.2. UN proper shipping name	ENVIRONMENTALLY HAZARDOUS SUBSTANCE, SOLID, N.O.S. (contains zinc oxide)		
14.3. Transport hazard class(es)	IMDG Class	9	
	IMDG Subsidiary Hazard	Not Applicable	
14.4. Packing group	III		
14.5. Environmental hazard	Marine Pollutant		
14.6. Special precautions for user	EMS Number	F-A, S-F	
	Special provisions	274 335 966 967 969	
	Limited Quantities	5 kg	

14.7.1. Transport in bulk according to Annex II of MARPOL and the IBC code

Not Applicable

14.7.2. Transport in bulk in accordance with MARPOL Annex V and the IMSBC Code

Product name	Group
zinc oxide	Not Available

Product name	Group
C.I. Pigment White 6	Not Available

14.7.3. Transport in bulk in accordance with the IGC Code

Product name	Ship Type
zinc oxide	Not Available
C.I. Pigment White 6	Not Available

SECTION 15 Regulatory information

Safety, health and environmental regulations / legislation specific for the substance or mixture

zinc oxide is found on the following regulatory lists

International WHO List of Proposed Occupational Exposure Limit (OEL) Values for Manufactured Nanomaterials (MNM/S)	US EPA Integrated Risk Information System (IRIS)
US - Alaska Air Quality Control - Concentrations Triggering an Air Quality Episode for Air Pollutants Other Than PM-2.5	US EPCRA Section 313 Chemical List
US - Massachusetts - Right To Know Listed Chemicals	US NIOSH Recommended Exposure Limits (RELs)
US CWA (Clean Water Act) - Priority Pollutants	US OSHA Permissible Exposure Limits (PELs) Table Z-1
US CWA (Clean Water Act) - Toxic Pollutants	US OSHA Permissible Exposure Limits (PELs) Table Z-3
US DOE Temporary Emergency Exposure Limits (TEELs)	US Toxic Substances Control Act (TSCA) - Chemical Substance Inventory

C.I. Pigment White 6 is found on the following regulatory lists

Chemical Footprint Project - Chemicals of High Concern List	US - Massachusetts - Right To Know Listed Chemicals
International Agency for Research on Cancer (IARC) - Agents Classified by the IARC Monographs	US DOE Temporary Emergency Exposure Limits (TEELs)
International Agency for Research on Cancer (IARC) - Agents Classified by the IARC Monographs - Group 2B: Possibly carcinogenic to humans	US NIOSH Carcinogen List
International WHO List of Proposed Occupational Exposure Limit (OEL) Values for Manufactured Nanomaterials (MNM/S)	US NIOSH Recommended Exposure Limits (RELs)
US - Alaska Air Quality Control - Concentrations Triggering an Air Quality Episode for Air Pollutants Other Than PM-2.5	US OSHA Permissible Exposure Limits (PELs) Table Z-1
US - California Proposition 65 - Carcinogens	US OSHA Permissible Exposure Limits (PELs) Table Z-3
US - California Safe Drinking Water and Toxic Enforcement Act of 1986 - Proposition 65 List	US Toxic Substances Control Act (TSCA) - Chemical Substance Inventory

Federal Regulations

Superfund Amendments and Reauthorization Act of 1986 (SARA)

Section 311/312 hazard categories

Flammable (Gases, Aerosols, Liquids, or Solids)	No
Gas under pressure	No
Explosive	No
Self-heating	No
Pyrophoric (Liquid or Solid)	No
Pyrophoric Gas	No
Corrosive to metal	No
Oxidizer (Liquid, Solid or Gas)	No
Organic Peroxide	No
Self-reactive	No
In contact with water emits flammable gas	No
Combustible Dust	No
Carcinogenicity	No
Acute toxicity (any route of exposure)	No
Reproductive toxicity	No
Skin Corrosion or Irritation	No
Respiratory or Skin Sensitization	No

Guttapercha Points

Serious eye damage or eye irritation	No
Specific target organ toxicity (single or repeated exposure)	No
Aspiration Hazard	No
Germ cell mutagenicity	No
Simple Asphyxiant	No
Hazards Not Otherwise Classified	No

US. EPA CERCLA Hazardous Substances and Reportable Quantities (40 CFR 302.4)

None Reported

State Regulations

US. California Proposition 65

 **WARNING:** This product can expose you to chemicals including **C.I. Pigment White 6**, which is known to the State of California to cause cancer. For more information, go to www.P65Warnings.ca.gov

National Inventory Status

National Inventory	Status
Australia - AIIC / Australia Non-Industrial Use	Yes
Canada - DSL	Yes
Canada - NDSL	No (C.I. Pigment White 6)
China - IECSC	Yes
Europe - EINEC / ELINCS / NLP	Yes
Japan - ENCS	Yes
Korea - KECI	Yes
New Zealand - NZIoC	Yes
Philippines - PICCS	Yes
USA - TSCA	Yes
Taiwan - TCSI	Yes
Mexico - INSQ	Yes
Vietnam - NCI	Yes
Russia - FBEPH	Yes
Legend:	Yes = All CAS declared ingredients are on the inventory No = One or more of the CAS listed ingredients are not on the inventory. These ingredients may be exempt or will require registration.

SECTION 16 Other information

Revision Date	02/11/2022
Initial Date	31/01/2022

SDS Version Summary

Version	Date of Update	Sections Updated
1.2	02/11/2022	Toxicological information - Chronic Health, Hazards identification - Classification, Exposure controls / personal protection - Exposure Standard, Composition / information on ingredients - Ingredients

Other information

Classification of the preparation and its individual components has drawn on official and authoritative sources as well as independent review by the Chemwatch Classification committee using available literature references.

The SDS is a Hazard Communication tool and should be used to assist in the Risk Assessment. Many factors determine whether the reported Hazards are Risks in the workplace or other settings. Risks may be determined by reference to Exposures Scenarios. Scale of use, frequency of use and current or available engineering controls must be considered.

Powered by AuthoriTe, from Chemwatch.